

Littlite®

Goosenecks and Accessories

Surface Mounting Your Littlite Lampset

All L-series Littlite lampsets are designed to be surface mounted without any additional accessories required. The lampset can be mounted from the top or underside of the mounting surface.

MOUNTING FROM THE TOP OF THE MOUNTING SURFACE.

Remove the Chassis Plate Screws {C} from the top of the lampset (Figure 1).

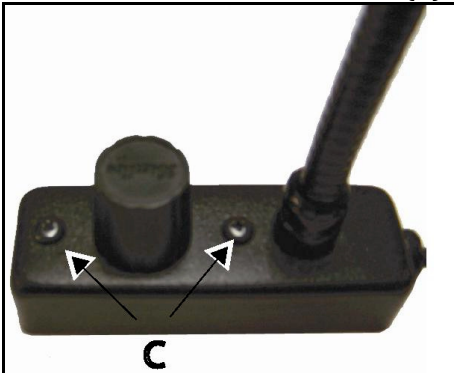


Figure 1.

On a standard Littlite lampset this will enable the chassis plate {A} to be removed from the chassis assembly (Figure 2).

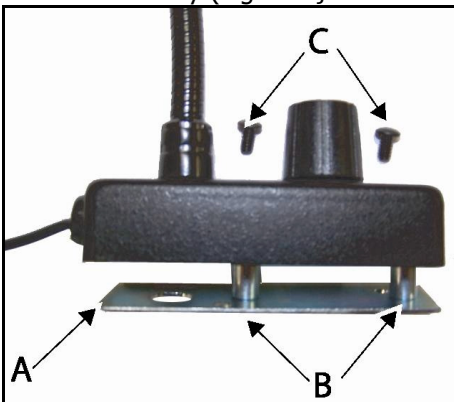


Figure 2.

Once the chassis plate {A} is removed position it on the mounting surface and secure it to the surface via the two screw holes {E} on the plate. (Figure 3).

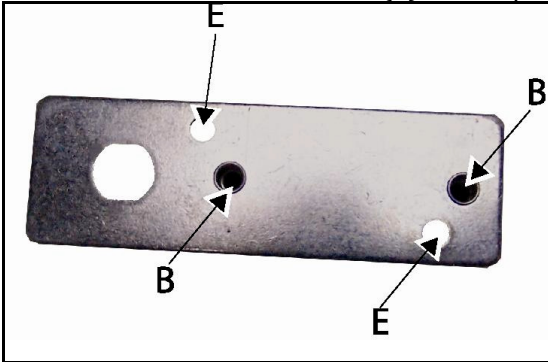


Figure 3.

Reattach the chassis and install the chassis plate screws {C}.

MOUNTING FROM THE BOTTOM OF THE SURFACE

Turn over your Littlite lampset and locate the two threaded posts {B} on the bottom of the chassis plate {A}. (Figure 4)

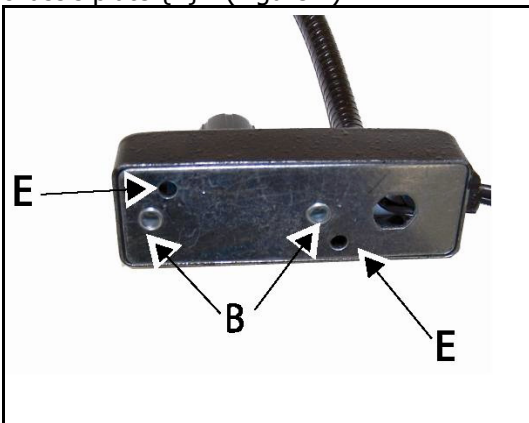


Figure 4.

Mark the location of the threaded posts on the mounting surface.

Drill two holes in the mounting surface large enough to accommodate the supplied machine screws {H}.

From beneath the mounting surface, insert the machine screws {H}, split washers {G} and flat washers {F} through the holes (Figure 5) and into the threaded posts {B}. Tighten the machine screws {H} to secure the lampset to the surface.

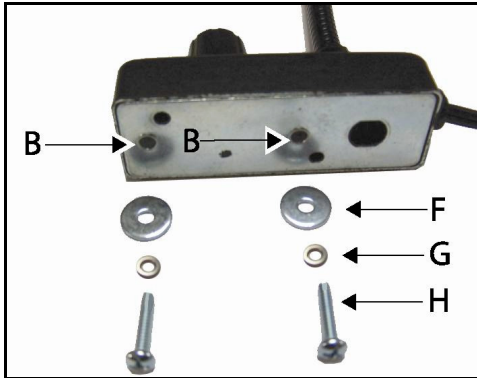


Figure 5.

AUTOMOTIVE SERIES LITTLITES

Directions for surface mounting L-5 and L-9 automotive series Littlite are identical to the standard lampsets except for the location of the cord set {D} (Figure 6)

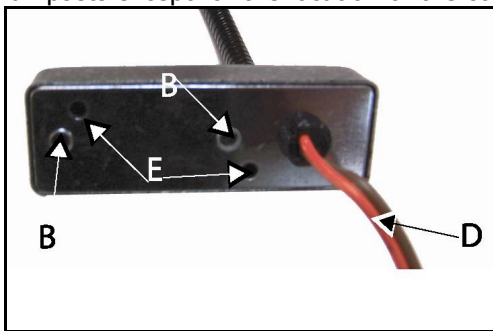


Figure 6.

Because the cord set {D} is routed through the bottom of the chassis plate {A} a hole is required in the mounting surface to accept the cord set and strain relief.

When removing the chassis plate {A} for top mounting purposes, the cord set will prevent the chassis plate from being removed from the lampset (Figure 7).

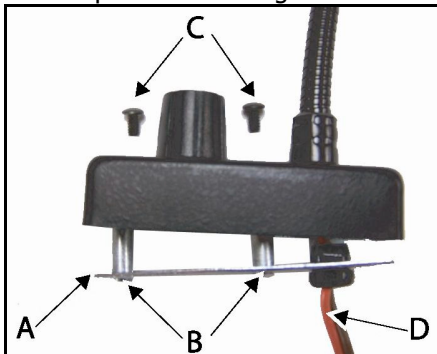


Figure 7.

Gently compress the stress relief with a pair of pliers and carefully pull it out of the hole and pull the cord set {D} through the hole. The chassis plate {A} will now be free to position on the mounting surface.


Mark the mounting surface for screw holes {E} and access hole for the cord set {D}.

Drill hole for cord set.

Pull the cord set {D} through the hole in the chassis plate, install the stress relief on the cord set by gently compressing the stress relief as you push it back into the hole in the chassis plate.

Pull cord set through access hole and secure chassis plate to mounting surface via two screw holes {E}.

Reattach the chassis and install the chassis plate screws {C}.

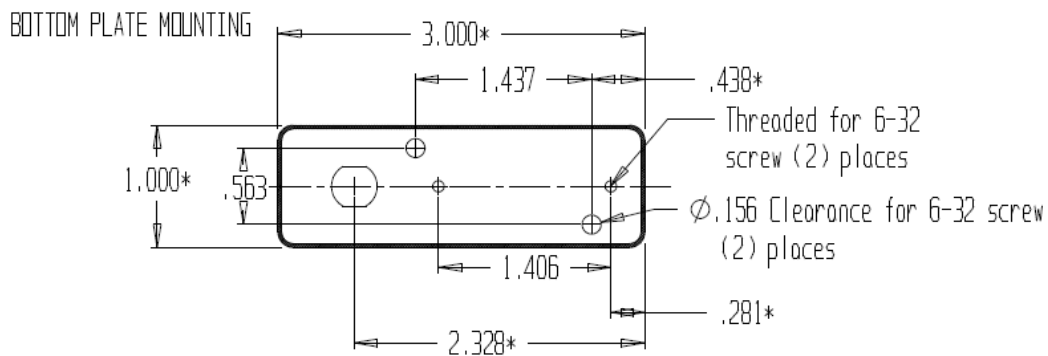

NOTE: * Dimensions are from outside edges of chassis.

© 2014 Littlite, LLC.

Littlite LLC, PO Box 430 Hamburg, MI 48139
www.littlite.com www.littlitedirect.com
(810) 852-4242 info@littlite.com